
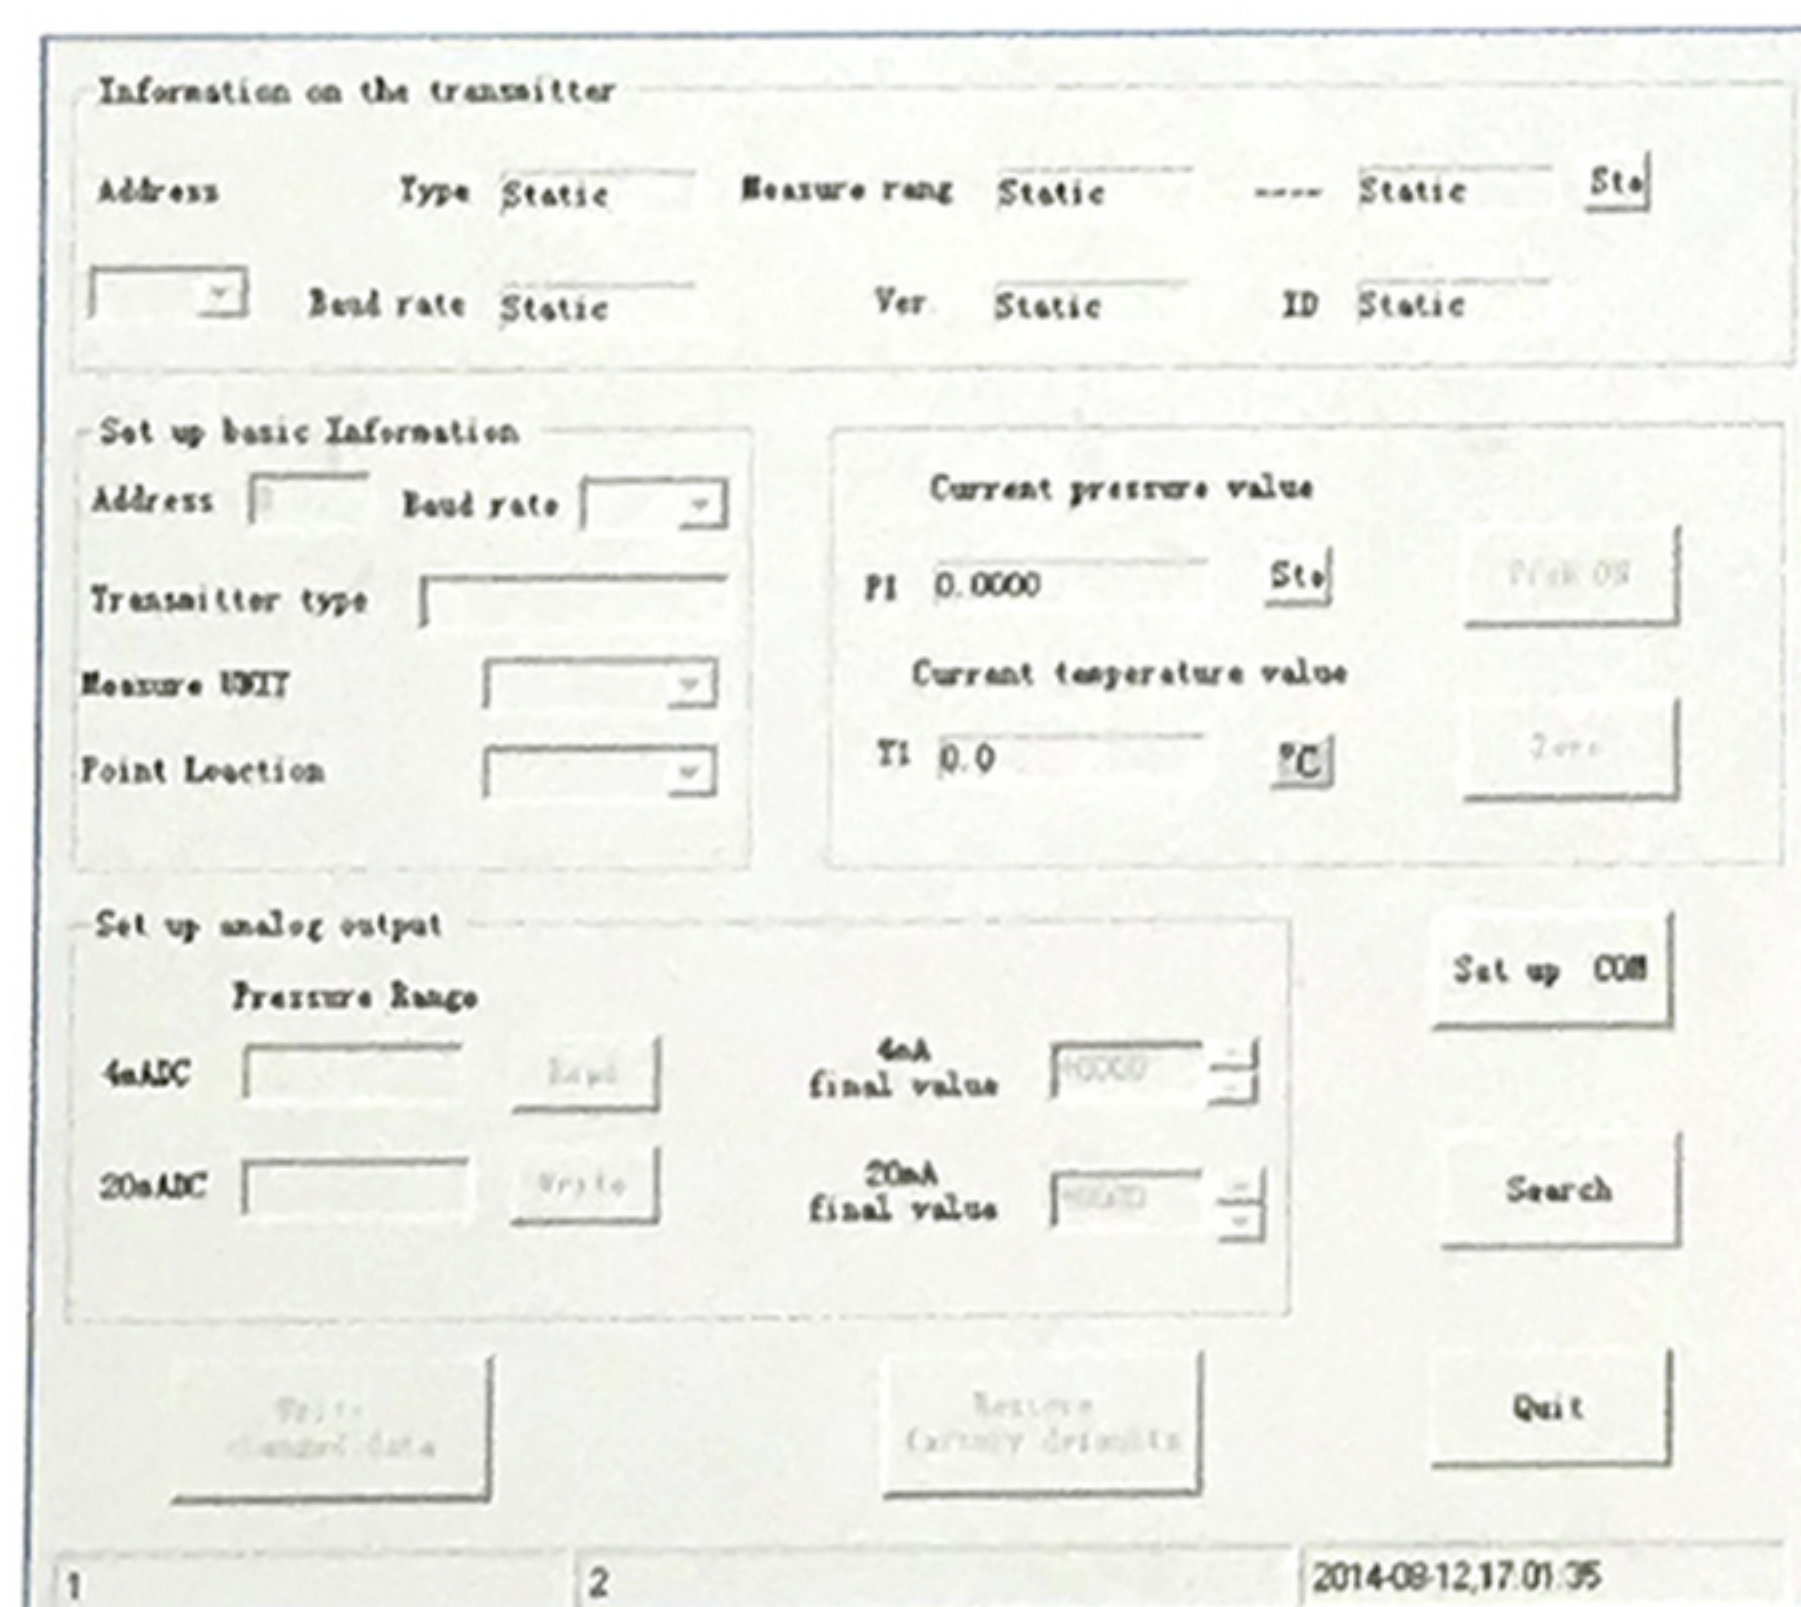


PRESSURE TRANSMITTER

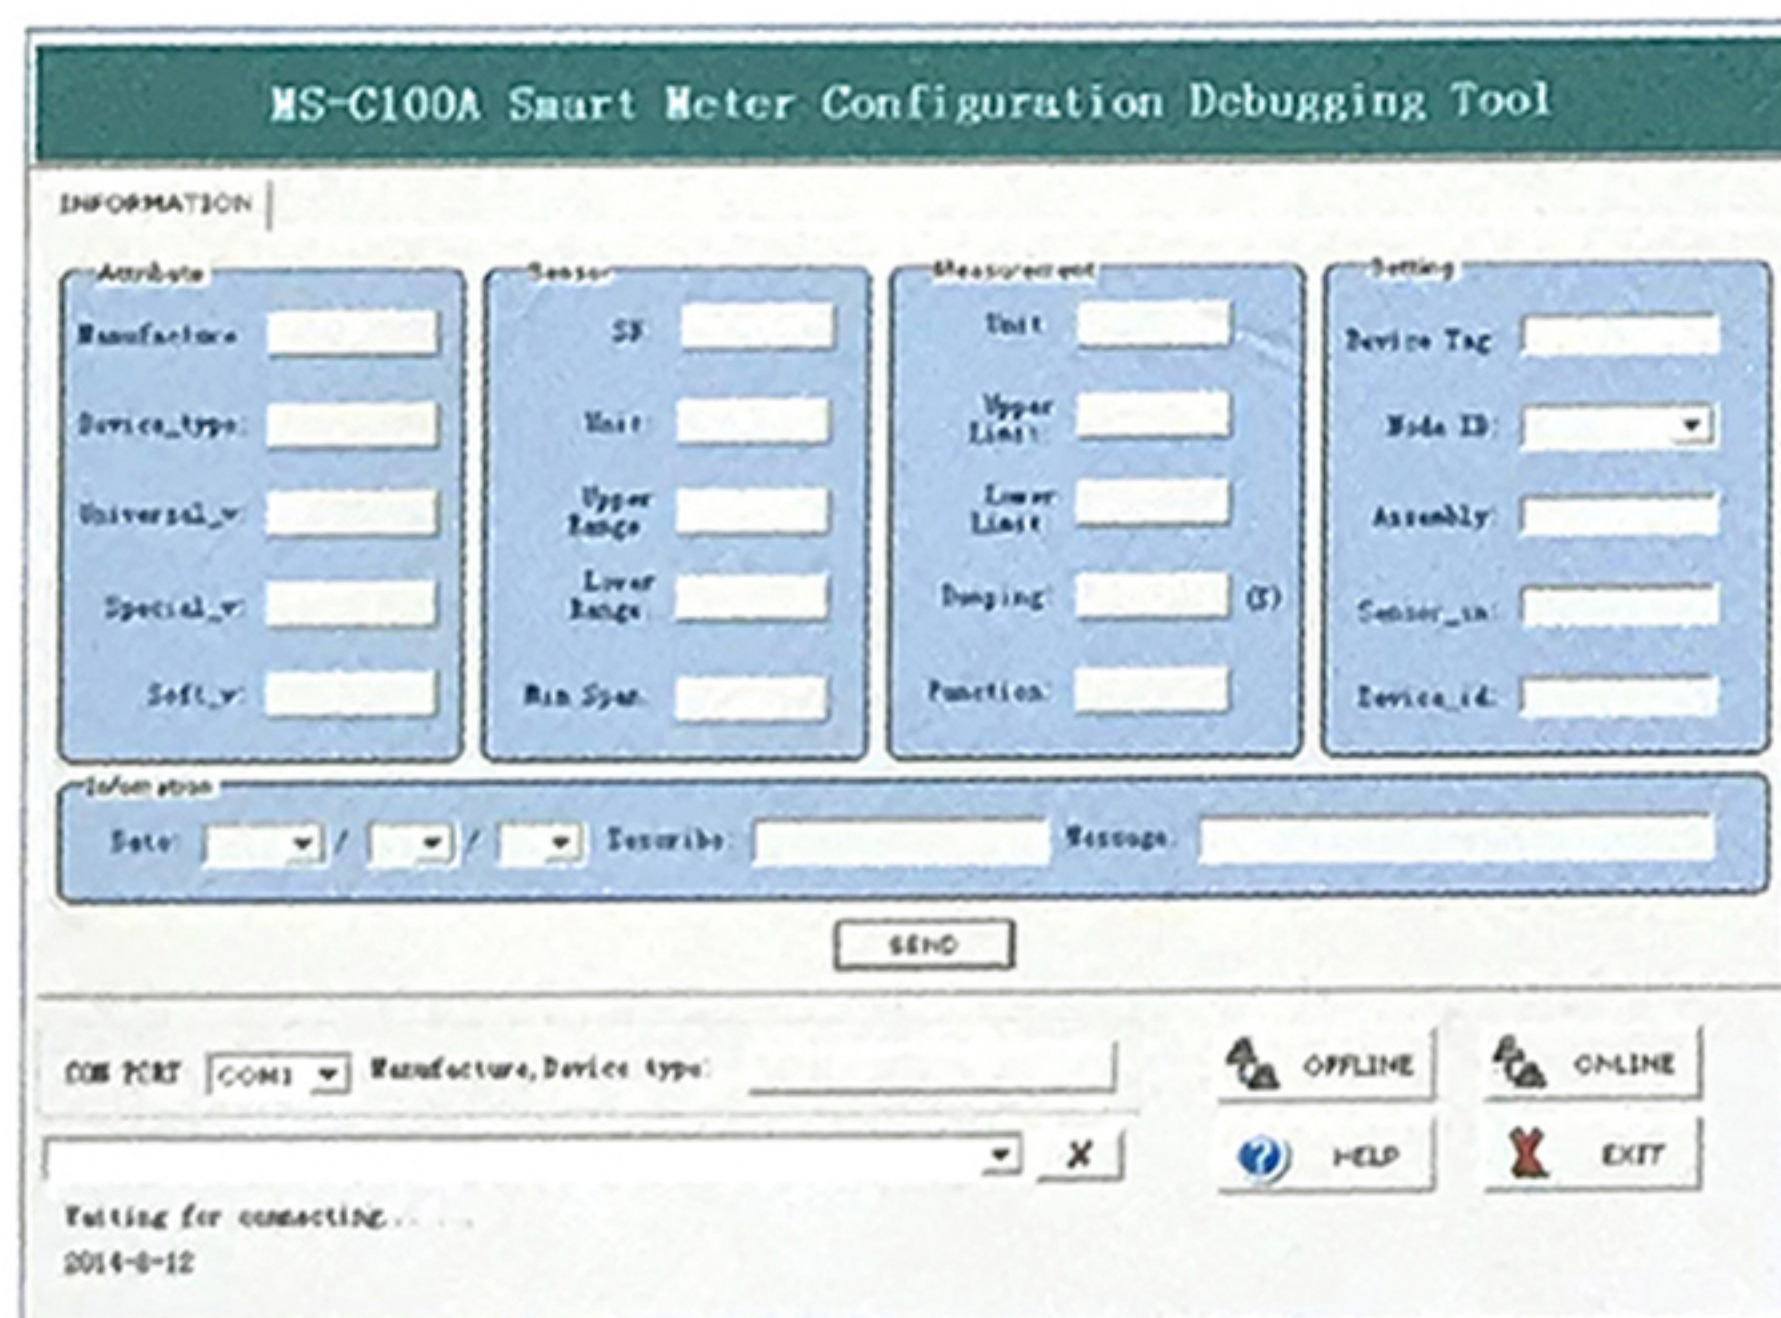

MPM486

HART® protocol intelligent piezoresistive pressure transmitter

Pressure Range: 0 ~ 0.07...100MPa
 Overpressure: 1.5×FS(Max.110MPa)
 Power Supply: 12 ~ 36V DC
 Output: 4 ~ 20mA DC + HART®
 Accuracy: ±0.1%FS(Typ.), ±0.25%FS(Max.)
 Long Term Stability: 0.25%FS/year
 Operating Temp.: -20℃ ~ 80℃
 Compensated Temp.: -10℃ ~ 80℃
 Display: LCD indicator, 2 or 3 keys to calibrate



MPM4760

High accuracy digital display intelligent piezoresistive pressure transmitter

Pressure Range: 0 ~ 0.1...100MPa
 Overpressure: 1.5×FS(Max. 110MPa)
 Power Supply: 8 ~ 28V DC
 Output: 4~20mA; RS485
 Total Accuracy(Lin.+Hys.+Rep.+Thermal error):
 ±0.1%FS(Min.), ±0.25%FS (Typ.), ±0.5%FS(Max.)
 Long Term Stability: ±0.25%FS/year
 Compensated Temp.: -10℃ ~ 70℃
 Operating Temp.: -30℃ ~ 80℃